

NPI MISSOURI INC

636-940-1005 clientcare@npimo.com http://www.npimo.com



RESIDENTIAL REPORT

9084 Hwy HH Robertsville, MO 63072

> Andrew "Bo" Tierney JANUARY 29, 2024



Inspector
Robert Gould
ASHI #205896, Qualified MO Septic
Inspector #50581
636-940-1005
clientcare@npimo.com



Inspector
Will Gould
636-940-1005
clientcare@npimo.com



Agent
Eric Merchant
Trophy Properties & Auction
(314) 541-1218
emerchant@trophypa.com

TABLE OF CONTENTS

1: Inspection Details	4
2: Structural Components	7
3: Exterior	11
4: Roofing	19
5: Plumbing	21
6: Electrical	25
7: Heating	28
8: Air Conditioning	30
9: Interiors	31
10: Built-in Appliances	35
11: Insulation and Ventilation	37
12: Fireplaces and Fuel-Burning Appliances	38
Standards of Practice	39

NPI Missouri Inc Page 2 of 40

SUMMARY







RECOMMENDATIONS

- 2.2.1 Structural Components Floor Structure: Previous Repairs
- 2.2.2 Structural Components Floor Structure: Support Post Deficiencies
- 3.1.1 Exterior Siding, Flashing & Trim: Damaged siding
- 3.1.2 Exterior Siding, Flashing & Trim: Previous Repairs
- 3.4.1 Exterior Decks, Balconies, Porches & Steps: Missing Safety Straps
- 3.4.2 Exterior Decks, Balconies, Porches & Steps: Damaged Components
- 3.4.3 Exterior Decks, Balconies, Porches & Steps: Deck Maintenance
- 3.5.1 Exterior Vegetation, Grading, Drainage & Retaining Walls: Near Level Grade
- 3.6.1 Exterior Walkways, Patios & Driveways: Driveway Cracking Major
- 4.4.1 Roofing Skylights, Chimneys & Roof Penetrations: Chase Cover
- 5.2.1 Plumbing Drain, Waste, & Vent Systems: Flex Drain
- 5.2.2 Plumbing Drain, Waste, & Vent Systems: Improper Installation Vent
- 5.2.3 Plumbing Drain, Waste, & Vent Systems: Seepage
- 5.8.1 Plumbing Septic System: Maintenace Required
- 6.7.1 Electrical GFCI & AFCI: No GFCI Protection Installed
- 6.7.2 Electrical GFCI & AFCI: Inoperable/Damaged
- 7.1.1 Heating Heating Equipment: Not Inspected
- 8.1.1 Air Conditioning Cooling Equipment: Unit Not Cycled
- 9.3.1 Interiors Floors: Buckled carpet
- 9.6.1 Interiors Doors: Trim Door
- 9.7.1 Interiors Windows: Broken glass
- △ 9.8.1 Interiors Garage Door: Opener defects
- 9.8.2 Interiors Garage Door: Opener defects
- 10.1.1 Built-in Appliances Dishwasher: Inoperable
- 10.3.1 Built-in Appliances Range/Oven/Cooktop: Range Not Fastened
- O 10.5.1 Built-in Appliances Design Life: Beyond Design Life
- 12.3.1 Fireplaces and Fuel-Burning Appliances Chimney & Vent Systems: Cleaning

NPI Missouri Inc Page 3 of 40

1: INSPECTION DETAILS

Information

Occupied

Vacant

Type of Building

Single Family

Style

Rustic, Ranch

Weather Conditions

Clear, Damp Soil, Recent Rain

Temperature (approximate)

34 Fahrenheit (F)

NPI Missouri Inc Page 4 of 40

Report Info

Home

CATEGORIES:

This report divides deficiencies into three categories; Maintenance Items (colored in BLUE), Recommendations (in ORANGE), and MAJOR CONCERN/SAFETY (in RED).

MAINTENANCE ITEMS: Include components that were found to be in need of recurring or basic general maintenance to protect either a the component or the occupants. Also included in this section are items that were beginning to show signs of wear, but were, in the opinion of the inspector, still functional at the time of inspection. Typically these items are considered to represent a less significant immediate cost than those listed in the following two categories.

RECOMMENDATIONS/REPAIR: Include comments of a deficiency, a latent defect or a suggested improvement of a system which may have appeared functional at the time of inspection, however some benefit may be achieved by adhering to the recommendation.

MAJOR CONCERN/SAFETY: Will denote a brief comment of a significantly deficient component or a condition, which may require a relatively expensive correction and/or replacement or a Safety Item, which may not be severe, but we want you to know its in need of more immediate attention. These will typically fall into one of the following four categories:

- 1. Major defects. An example of this would be a structural failure, roof replacement etc..
- 2. Items costing over \$1000 or for repair/replacement.
- 3. Safety hazards such as an exposed wire, or double taps at main etc...

Anything in these categories should be addressed. Often, a serious problem can be corrected inexpensively to protect both life and property.

This categorization is the opinion of the inspector and is based on what was observed at the time of inspection. It is not intended to imply that items documented in any one category are not in need of correction. Maintenance items or latent defects not repaired in a reasonable amount of time, can soon become significant defects. It should be considered very likely there will be other issues you personally may consider deficient, and you should add these as desired. There may also be defects that you feel belong in a different category, and again, you should feel free to consider the importance you believe they hold and act accordingly.

Please review the report in its entirety. It is ultimately up to your discretion to interpret its findings and to act accordingly. This report does not offer an opinion as to whom among the parties to this transaction should take responsibility for addressing any of these concerns. As with all aspects of your transaction, you should consult with your Realtor® for further advice regarding the contents of this report. Any repairs should be performed by the applicable licensed and bonded tradesman or qualified professional who will provide copies of all receipts, warranties and applicable permits for any repairs that are carried out.

The report lists deficiencies visible at the time of inspection. The inspector is not required to move furniture, appliances, storage, or disassemble components beyond normal user controls nor perform destructive testing. National Property Inspections does not accept responsibility for hidden or latent defects discovered upon occupancy or during remodeling after the date of inspection. Please note that our inspection is thorough but not technically exhaustive. The intent of this inspection is to discover significant defects as it is not possible to detect every maintenance or minor repair item. Most homes continue to be occupied after our inspections, thus we do not warrant 100% discovery of all maintenance or minor repair items such as drippy faucets, isolated wood damage, light switch functionality, etc. We do not inspect for county or municipal code compliance as the St. Louis Metro area and adjacent counties have many jurisdictions, thus codes are interpreted and enforced differently. National Property Inspections has no legal authority to mandate compliance to the municipal codes and ordinances. This report does not list municipal or county code infractions.

Use of Report

Our inspection report is for the use of our client(s). This report is only for the benefit of the person(s) listed on this report unless specifically agreed to otherwise in writing.

The summary section pages are not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your real estate agent or an attorney.

NOT A GUARANTEE

National Property Inspections does not guarantee future performance or provide a warranty, expressed or implied, regarding the inspected property after or during the date of inspection. Warranty policies are readily available for purchase. We are not liable for defects covered by the homeowner's hazard insurance policy or items covered by a warranty program. Should you discover a defect for which you think National Property Inspections may be liable, you must notify us within 24 hours and provide a reasonable opportunity of 2 to 5 business days to reinspect the property before the defect is repaired. If National Property Inspections is not given the opportunity to review an alleged liability, we do not accept any responsibility for the claim. Even properties vacant between the time of inspection and closing can develop mechanical, electrical or plumbing defects. The purchaser's pre-closing final walk through is extremely important to confirm that all systems are operable, that maintenance or repair issues have not developed since the

NPI Missouri Inc Page 5 of 40

inspection and any requested repairs have been completed to your satisfaction. National Property Inspections accepts no responsibility for defects that could have been observed during the final walk through, provided by the St. Louis Association of Realtors Residential Sales Contract.

Information in this report is based on a limited visual examination given the current conditions at the time of the inspection. This information can help you understand the risks of owning this property but it cannot eliminate those risks, nor can it specifically predict future performance. We help you assess these risks; we do not assume them for you.

Code and Environmental Issues Excluded

We do not include inspection for "code" compliance. As contractors make repairs or do maintenance to the home, you should expect the need to update items to meet current code requirements. This may substantially increase cost of the repairs.

We do not include inspection or testing for EPA listed or any other environmental hazards or materials such as asbestos, mold, lead paint, underground storage tank or other environmentally related items, unless ordered and paid for at the time of the inspection.

We do not inspect for termites or other vermin unless ordered and paid for during this inspection.

Photograph Info

Photos are inserted throughout the report and are intended to be used to help further explain the conditions described. The photographs are an example of the condition described and may not show the entire deficiency or all occurrences of the same deficiency.

NPI Missouri Inc Page 6 of 40

2: STRUCTURAL COMPONENTS

		IN	NI	NP	0
2.1	Foundation, Basement & Crawlspaces	Χ			
2.2	Floor Structure	Χ			Χ
2.3	Wall Structure	Χ			
2.4	Ceiling Structure	Χ			
2.5	Roof Structure & Attic	Χ			

Information

Floor Structure:

Basement/Crawlspace Floor

Concrete

Wall Structure: Material

Wood

Floor Structure: Material

Dimensional Lumber

Ceiling Structure: Material

Wood

Floor Structure: Sub-floor

Plywood


Roof Structure & Attic: Type

Gable

NPI Missouri Inc Page 7 of 40

Foundation, Basement & Crawlspaces: Foundation

Concrete, Basement

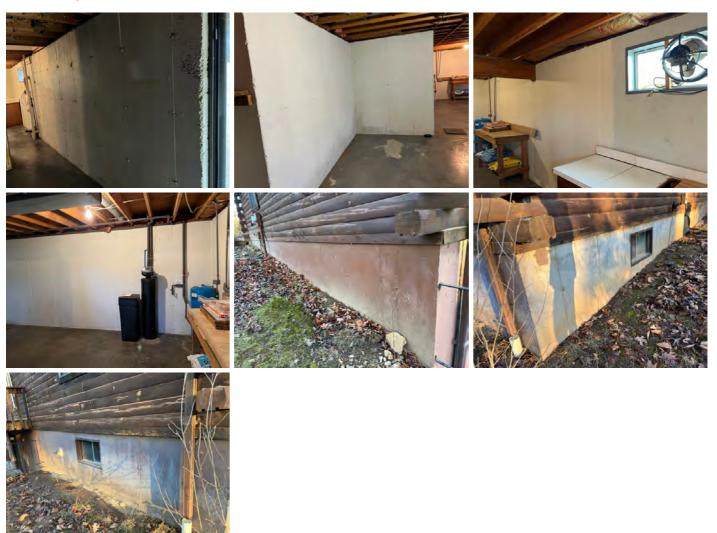

NPI Missouri Inc Page 8 of 40

Roof Structure & Attic: Material

Plywood



Observations

2.2.1 Floor Structure

PREVIOUS REPAIRS

GARAGE/BASEMENT

Additional floor support has been installed in the garage due to floor settlement. Support appears to be performing as intended.

Recommendation

Contact a qualified professional.





NPI Missouri Inc Page 9 of 40

2.2.2 Floor Structure

SUPPORT POST DEFICIENCIES



BASEMENT

Mechanical connectors are not present at the beams and support posts.

Recommendation

Contact a qualified professional.







NPI Missouri Inc Page 10 of 40

3: EXTERIOR

		IN	NI	NP	0
3.1	Siding, Flashing & Trim	Χ			Χ
3.2	Eaves, Soffits & Fascia	Χ			
3.3	Exterior Doors	Χ			
3.4	Decks, Balconies, Porches & Steps	Χ			Χ
3.5	Vegetation, Grading, Drainage & Retaining Walls	Χ			
3.6	Walkways, Patios & Driveways	Χ			

Information

Inspection Method

Visual, Attic Access

Siding, Flashing & Trim: Siding Material

Wood

Decks, Balconies, Porches &

Steps: Carport

Deck with Steps, Front Porch

Decks, Balconies, Porches &

Steps: Material

Wood

Exterior Doors: Exterior Entry Door

Steel





NPI Missouri Inc Page 11 of 40


Walkways, Patios & Driveways: Flatwork Material

Concrete, Gravel







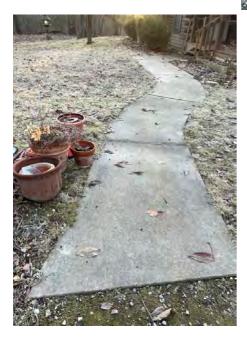

Observations

3.1.1 Siding, Flashing & Trim

DAMAGED SIDING

CHIMNEY CHASE



Wood siding on the chimney chase is beyond design life, excessively deteriorated and previously repaired in several areas. Recommend replacing to eliminate further deterioration and water intrusion.

Recommendation

Contact a qualified professional.

NPI Missouri Inc Page 12 of 40



















NPI Missouri Inc Page 13 of 40

3.1.2 Siding, Flashing & Trim

PREVIOUS REPAIRS

SIDING

Previous repairs are present to carpenter bee damage throughout the exterior.





3.4.1 Decks, Balconies, Porches & Steps

Recommendations

MISSING SAFETY STRAPS

Recommend safety straps be installed on stair stringers.

Recommendation

Contact a handyman or DIY project

NPI Missouri Inc Page 14 of 40



3.4.2 Decks, Balconies, Porches & Steps

- Recommendations

DAMAGED COMPONENTS

FRONT PORCH

General deterioration, weather damaged components, and poor wood the earth clearance are present in the front porch and stairs. Recommended maintenance or replacement to prevent further deterioration.

Recommendation

Contact a qualified professional.














NPI Missouri Inc Page 15 of 40

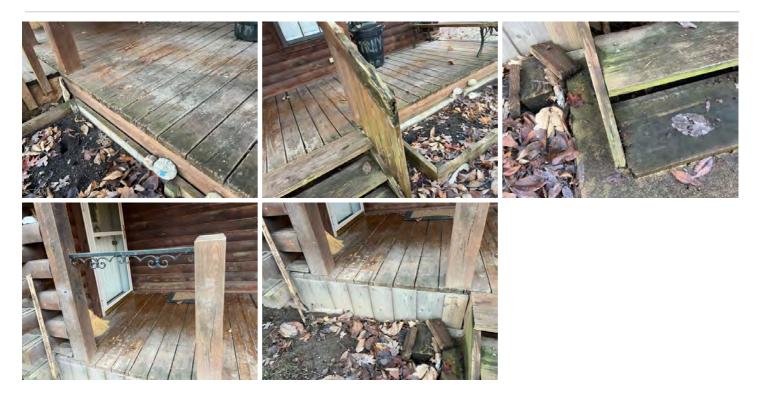

3.4.3 Decks, Balconies, Porches & Steps

DECK MAINTENANCE

DRCK

Deck floor boards and rail components are deteriorated and in need of replacement.

Recommendation


Contact a qualified professional.







NPI Missouri Inc Page 16 of 40

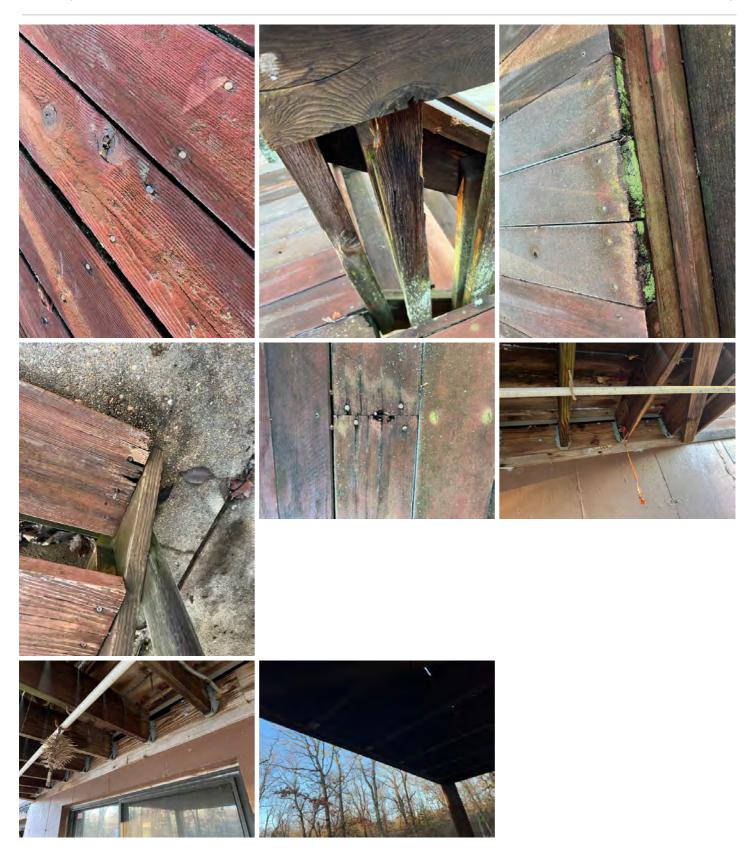

3.5.1 Vegetation, Grading, Drainage & Retaining Walls



NEAR LEVEL GRADE

EXTERIOR

Near level grade in front may result in poor drainage and water intrusion.

NPI Missouri Inc Page 17 of 40

Recommendation

Contact a qualified landscaping contractor



3.6.1 Walkways, Patios & Driveways

DRIVEWAY CRACKING - MAJOR

DRIVEWAY

Major cracking and deterioration observed. Recommend driveway contractor evaluate and replace.

Recommendation

Contact a qualified concrete contractor.



NPI Missouri Inc Page 18 of 40

4: ROOFING

		IN	NI	NP	0
4.1	Coverings	Χ			
4.2	Roof Drainage Systems	Χ			
4.3	Flashings	Χ			
4.4	Skylights, Chimneys & Roof Penetrations	Χ			

Information

Inspection Method

Roof

Flashings: Material

Aluminum

Roof Type/Style

Gable

Skylights, Chimneys & Roof



Roof Drainage Systems: Gutter

MaterialAluminum

NPI Missouri Inc Page 19 of 40

Coverings: MaterialAsphalt Shingles



Observations

4.4.1 Skylights, Chimneys & Roof Penetrations



CHASE COVER

ROOF

Recommend repairs or replacement to the negatively pitched and rusted chase cover to prevent further deterioration or water intrusion.

Recommendation

Contact a qualified roofing professional.





NPI Missouri Inc Page 20 of 40

5: PLUMBING

		IN	NI	NP	0
5.1	Fixtures / Faucets	Χ			
5.2	Drain, Waste, & Vent Systems	Χ			
5.3	Water distribution	Χ			
5.4	Water Heater	Χ			
5.5	Vents, Flues, & Chimneys	Χ			
5.6	Sump Pumps / Sewage Ejectors	Χ			
5.7	Fuel Storage & Distribution Systems	Χ			
5.8	Septic System	Χ			

Information

Filters

Whole house conditioner

Main Fuel Shut-Off (Location)

Basement, Electrical Panel, Propane Storage Tank

Main Water Shut-Off Device (Location)

Basement



Material - Distribution

Copper, PVC

Water Heater: Location

Basement

Material - Water Supply

Poly

Water Heater: Power Source

Gas

Water Heater: Capacity

50 40 Gallons

Septic System: Septic Report

See separate State Septic Form

details.

NPI Missouri Inc Page 21 of 40

Source

Well





Drain, Waste, & Vent Systems: Material PVC





NPI Missouri Inc Page 22 of 40

Water Heater: Manufacturer

State





Limitations

Fuel Storage & Distribution Systems

SEE SEPARATE GAS INSPECTION

Observations

5.2.1 Drain, Waste, & Vent Systems



FLEX DRAIN

Recommend removal and replacement of all flex drains with solid pvc pipe to prevent leaking and water damage.

Recommendation

Contact a qualified plumbing contractor.



5.2.2 Drain, Waste, & Vent Systems

IMPROPER INSTALLATION - VENT

BASEMENT

Trap is not installed at laundry drain in the waste stack. Open vent is present.

Recommendation

Contact a handyman or DIY project

NPI Missouri Inc Page 23 of 40



5.2.3 Drain, Waste, & Vent Systems



SEEPAGE

BATHTOOM

Evidence of previous seepage is present at the drain connection.

Recommendation

Contact a handyman or DIY project



5.8.1 Septic System

MAINTENACE REQUIRED

See separate septic report for required maintenance.

Recommendation

Contact a qualified professional.



NPI Missouri Inc Page 24 of 40

6: ELECTRICAL

		IN	NI	NP	0
6.1	Service Entrance Conductors	Χ			
6.2	Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels	Х			
6.3	Sub-Panel	Χ			
6.4	Branch Circuit Conductors, Overcurrent Devices and Compatibility of Their Amperage & Voltage	Х			
6.5	Connected Devices and Fixtures	Χ			
6.6	Polarity and Grounding of Receptacles	Χ			
6.7	GFCI & AFCI	Χ			
6.8	Smoke Detectors	Χ			
6.9	Carbon Monoxide Detectors	Χ			

IN = Inspected NI = Not Inspected NP = Not Present O = Observations

Information

Branch Wire 15 and 20 AMP

Wiring Method Copper Romex

Service Entrance Conductors: Electrical Service Conductors Below Ground, Aluminum



Page 25 of 40 NPI Missouri Inc

Service and Grounding
Equipment, Main Overcurrent
Device, Main and Distribution
Panels: Panel Capacity
200 AMP



Service and Grounding
Equipment, Main Overcurrent
Device, Main and Distribution
Panels: Panel Locations
Basement

Service and Grounding
Equipment, Main Overcurrent
Device, Main and Distribution
Panels: Panel Type
Circuit Breaker

Limitations

Smoke Detectors


OPERATION

Recommend all detectors be tested and replaced as required upon occupancy.

Observations

6.7.1 GFCI & AFCI

NO GFCI PROTECTION INSTALLED

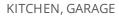



Here is a link to read about how GFCI receptacles keep you safe.

Recommendation

Contact a qualified electrical contractor.



NPI Missouri Inc Page 26 of 40





6.7.2 GFCI & AFCI

INOPERABLE/DAMAGED

BATHROOMS

Gfci receptacles do not trip and reset as intended.

Recommendation

Contact a qualified professional.







NPI Missouri Inc Page 27 of 40

7: HEATING

		IN	NI	NP	0
7.1	Heating Equipment	Χ			Х
7.2	Distribution Systems	Χ			
7.3	Vents, Flues & Chimneys	Χ			

Heating Equipment: Filter Type

Disposable

Forced Air

Heating Equipment: Heat Type

Information

Heating Equipment: Energy

Source


Gas

Distribution Systems: Ductwork

Non-insulated

Heating Equipment: Brand

Carrier

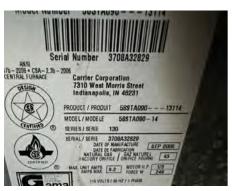




Observations

7.1.1 Heating Equipment

NOT INSPECTED

BASEMENT

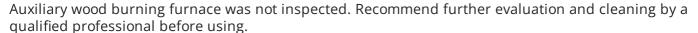

Recommendation

Contact a qualified professional.



NPI Missouri Inc Page 28 of 40





NPI Missouri Inc Page 29 of 40

8: AIR CONDITIONING

		IN	NI	NP	0
8.1	Cooling Equipment	Χ			
8.2	Distribution System	Χ			

Information

Cooling Equipment: Energy

Source/Type

Electric

Cooling Equipment: Brand

Carrier, Payne

Distribution System: Configuration

Split









Observations

8.1.1 Cooling Equipment

UNIT NOT CYCLED

Outside air temperature too low to cycle the unit(s). System(s) was visually inspected only.



NPI Missouri Inc Page 30 of 40

9: INTERIORS

		IN	NI	NP	0
9.1	Walls	Χ			
9.2	Ceilings	Χ			
9.3	Floors	Χ			
9.4	Steps, Stairways & Railings	Χ			
9.5	Countertops & Cabinets	Χ			
9.6	Doors	Χ			
9.7	Windows	Χ			
9.8	Garage Door	Χ			
9.9	Shower Enclosures	Χ			

IN = Inspected NI = Not Inspected NP =

NP = Not Present

O = Observations

Information

Walls: Finish MaterialDrywall, Wood

Windows: Window TypeDouble-hung, Thermal, Vinyl

Ceilings: Ceiling MaterialDrywall, Wood

Garage Door: MaterialAluminum



Countertops & Cabinets:

Cabinetry Wood

Garage Door: TypeUp-and-Over

Observations

9.3.1 Floors

BUCKLED CARPET



Maintenance or replacement recommended to the buckled carpet throughout the home to eliminate trip hazards.

Recommendation

Contact a qualified professional.

NPI Missouri Inc Page 31 of 40







9.6.1 Doors

TRIM DOOR



Doors are low and drag the floor. Recommend trimming the doors to eliminate carpet damage.

Recommendation

Contact a qualified professional.



9.7.1 Windows

BROKEN GLASS



BASEMENT

Cracked pain is present in the basement window. Recommend replacement.

Recommendation

Contact a qualified professional.


NPI Missouri Inc Page 32 of 40



9.8.1 Garage Door

OPENER DEFECTS



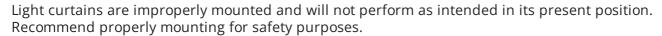

Recommendation

Contact a qualified professional.





Safety Hazards

9.8.2 Garage Door

OPENER DEFECTS



Opener does not perform as intended. Door reverses when wall button is released.

Recommendation

Contact a qualified professional.

NPI Missouri Inc Page 33 of 40



NPI Missouri Inc Page 34 of 40

10: BUILT-IN APPLIANCES

		IN	NI	NP	0
10.1	Dishwasher	Χ			
10.2	Refrigerator	Χ			
10.3	Range/Oven/Cooktop	Χ			
10.4	Garbage Disposal	Χ			
10.5	Design Life	Χ			
10.6	Microwave	Χ			

IN = Inspected NI = Not Inspected NP = Not Present O = Observations

Information

Range/Oven/Cooktop: Exhaust

Hood Type Re-circulate Range/Oven/Cooktop: **Range/Oven Energy Source**

Gas

Observations

10.1.1 Dishwasher

INOPERABLE



Dishwasher was not operating at the time of inspection. Recommend further evaluation and repair or replacement.





10.3.1 Range/Oven/Cooktop

RANGE NOT FASTENED

KITCHEN

Range is not fastened to the floor. This poses a safety hazard. Recommend securing for safety purposes.

Recommendation

Contact a handyman or DIY project



NPI Missouri Inc Page 35 of 40

10.5.1 Design Life

BEYOND DESIGN LIFE

Appliances are beyond design life.



NPI Missouri Inc Page 36 of 40

11: INSULATION AND VENTILATION

		IN	NI	NP	0
11.1	Attic Insulation	Χ			
11.2	Ventilation	Χ			
11.3	Exhaust Systems	Χ			

NP = Not Present

O = Observations

Information

Dryer Power Source 220 Electric

Dryer Vent Metal (Flex) **Ventilation:** Ventilation Type Gable Vents, Ridge Vents



Exhaust Systems: Exhaust Fans

Fan with Light

Attic Insulation: Insulation Type

Blown, Cellulose









NPI Missouri Inc Page 37 of 40

12: FIREPLACES AND FUEL-BURNING APPLIANCES

		IN	NI	NP	0
12.1	Fireplaces, Stoves & Inserts	Χ			
12.2	Fuel-buring Accessories	Χ			
12.3	Chimney & Vent Systems	Χ			

Information

Type

Wood, Metal

Observations

12.3.1 Chimney & Vent Systems



CLEANING

Highly recommend fireplace, flue and chimney be cleaned and inspected for safety purposes.

Recommendation

Contact a qualified professional.

NPI Missouri Inc Page 38 of 40

STANDARDS OF PRACTICE

Structural Components

3. STRUCTURAL COMPONENTS 3.1 The inspector shall: A. inspect structural components including the foundation and framing. B. describe: 1. the methods used to inspect under floor crawlspaces and attics. 2. the foundation. 3. the floor structure. 4. the wall structure. 5. the ceiling structure. 6. the roof structure. 3.2 The inspector is NOT required to: A. provide engineering or architectural services or analysis. B. offer an opinion about the adequacy of structural systems and components. C. enter under floor crawlspace areas that have less than 24 inches of vertical clearance between components and the ground or that have an access opening smaller than 16 inches by 24 inches. D. traverse attic load-bearing components that are concealed by insulation or by other materials.

Exterior

4.1 The inspector shall: A. inspect: 1. wall coverings, flashing, and trim. 2. exterior doors. 3. attached and adjacent decks, balconies, stoops, steps, porches, and their associated railings. 4. eaves, soffits, and fascias where accessible from the ground level. 5. vegetation, grading, surface drainage, and retaining walls that are likely to adversely affect the building. 6. adjacent and entryway walkways, patios, and driveways. B. describe wall coverings. 4.2 The inspector is NOT required to inspect: A. screening, shutters, awnings, and similar seasonal accessories. B. fences, boundary walls, and similar structures. C. geological and soil conditions. D. recreational facilities. E. outbuildings other than garages and carports. F. seawalls, break-walls, and docks. G. erosion control and earth stabilization measures.

Roofing

5.1 The inspector shall: A. inspect: 1. roofing materials. 2. roof drainage systems. 3. flashing. 4. skylights, chimneys, and roof penetrations. B. describe: 1. roofing materials. 2. methods used to inspect the roofing. 5.2 The inspector is NOT required to inspect: A. antennas. B. interiors of vent systems, uses, and chimneys that are not readily accessible. C. other installed accessories.

Plumbing

6.1 The inspector shall: A. inspect: 1. interior water supply and distribution systems including fixtures and faucets. 2. interior drain, waste, and vent systems including fixtures. 3. water heating equipment and hot water supply systems. 4. vent systems, flues, and chimneys. 5. fuel storage and fuel distribution systems. 6. sewage ejectors, sump pumps, and related piping. B. describe: 1. interior water supply, drain, waste, and vent piping materials. 2. water heating equipment including energy source(s). 3. location of main water and fuel shut-off valves. 6.2 The inspector is NOT required to: A. inspect: 1. clothes washing machine connections. 2. interiors of vent systems, flues, and chimneys that are not readily accessible. 3. wells, well pumps, and water storage related equipment. 4. water conditioning systems. 5. solar, geothermal, and other renewable energy water heating systems. 6. manual and automatic re-extinguishing and sprinkler systems and landscape irrigation systems. 7. septic and other sewage disposal systems. B. determine: 1. whether water supply and sewage disposal are public or private. 2. water quality. 3. the adequacy of combustion air components. C. measure water supply low and pressure, and well water quantity. D. fill shower pans and fixtures to test for leaks.

Electrical

7.1 The inspector shall: A. inspect: 1. service drop. 2. service entrance conductors, cables, and raceways. 3. service equipment and main disconnects. 4. service grounding. 5. interior components of service panels and subpanels. 6. conductors. 7. overcurrent protection devices. 8. a representative number of installed lighting fixtures, switches, and receptacles. 9. ground fault circuit interrupters and arc fault circuit interrupters. B. describe: 1. amperage rating of the service. 2. location of main disconnect(s) and subpanels. 3. presence or absence of smoke alarms and carbon monoxide alarms. 4. the predominant branch circuit wiring method. 7.2 The inspector is NOT required to: A. inspect: 1. remote control devices. 2. or test smoke and carbon monoxide alarms, security systems, and other signaling and warning devices. 3. low voltage wiring systems and components. 4. ancillary wiring systems and components not a part of the primary electrical power distribution system. 5. solar, geothermal, wind, and other renewable energy systems. B. measure amperage, voltage, and impedance. C. determine the age and type of smoke alarms and carbon monoxide alarms.

Heating

8.1 The inspector shall: A. open readily openable access panels. B. inspect: 1. installed heating equipment. 2. vent systems, uses, and chimneys. 3. distribution systems. C. describe: 1. energy source(s). 2. heating systems. 8.2 The inspector is NOT required to: A. inspect: 1. interiors of vent systems, uses, and chimneys that are not readily accessible. 2. heat exchangers. 3. humidifiers and dehumidifiers. 4. electric air cleaning and sanitizing devices. 5. heating systems using ground-source, water-source, solar, and renewable energy technologies. 6. heat-recovery and similar whole-house mechanical ventilation systems. B. determine: 1. heat supply adequacy and distribution balance. 2. the adequacy of combustion air components.

Air Conditioning

NPI Missouri Inc Page 39 of 40

9.1 The inspector shall: A. open readily openable access panels. B. inspect: 1. central and permanently installed cooling equipment. 2. distribution systems. C. describe: 1. energy source(s). 2. cooling systems. 9.2 The inspector is NOT required to: A. inspect electric air cleaning and sanitizing devices. B. determine cooling supply adequacy and distribution balance. C. inspect cooling units that are not permanently installed or that are installed in windows. D. inspect cooling systems using ground source, water source, solar, and renewable energy technologies.

Interiors

10.1 The inspector shall inspect: A. walls, ceilings, and floors. B. steps, stairways, and railings. C. countertops and a representative number of installed cabinets. D. a representative number of doors and windows. E. garage vehicle doors and garage vehicle door operators. F. installed ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function. 10.2 The inspector is NOT required to inspect: A. paint, wallpaper, and other finish treatments. B. floor coverings. C. window treatments. D. coatings on and the hermetic seals between panes of window glass. E. central vacuum systems. F. recreational facilities. G. installed and free-standing kitchen and laundry appliances not listed in Section 10.1.F. H. appliance thermostats including their calibration, adequacy of heating elements, self cleaning oven cycles, indicator lights, door seals, timers, clocks, timed features, and other specialized features of the appliance. I. operate, or confirm the operation of every control and feature of an inspected appliance.

Built-in Appliances

10.1 The inspector shall inspect: F. installed ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function. 10.2 The inspector is NOT required to inspect: G. installed and free-standing kitchen and laundry appliances not listed in Section 10.1.F. H. appliance thermostats including their calibration, adequacy of heating elements, self cleaning oven cycles, indicator lights, door seals, timers, clocks, timed features, and other specialized features of the appliance. I. operate, or con rm the operation of every control and feature of an inspected appliance.

Insulation and Ventilation

11.1 The inspector shall: A. inspect: 1. insulation and vapor retarders in unfinished spaces. 2. ventilation of attics and foundation areas. 3. kitchen, bathroom, laundry, and similar exhaust systems. 4. clothes dryer exhaust systems. B. describe: 1. insulation and vapor retarders in unfinished spaces. 2. absence of insulation in unfinished spaces at conditioned surfaces. 11.2 The inspector is NOT required to disturb insulation.

Fireplaces and Fuel-Burning Appliances

12.1 The inspector shall: A. inspect: 1. fuel-burning replaces, stoves, and replace inserts. 2. fuel-burning accessories installed in replaces. 3. chimneys and vent systems. B. describe systems and components listed in 12.1.A.1 and .2. 12.2 The inspector is NOT required to: A. inspect: 1. interiors of vent systems, uses, and chimneys that are not readily accessible. 2. fire screens and doors. 3. seals and gaskets. 4. automatic fuel feed devices. 5. mantles and replace surrounds. 6. combustion air components and to determine their adequacy. 7. heat distribution assists (gravity fed and fan assisted). 8. fuel-burning replaces and appliances located outside the inspected structures. B. determine draft characteristics. C. move fireplace inserts and stoves or firebox contents.

NPI Missouri Inc Page 40 of 40